Contents of the box:

This Guide

The Docking Station

Power adaptor and plugs

USB Micro-AB to A cable

Features: Front

Spare battery well

NEO compartment

LED indicator

Docking connector

Features: Back, Ports, And Battery Charge Well

Docking connector

NEO compartment

Drain hole

Battery contacts

Spare battery well

Drain hole

DC In port

Micro-USB connector
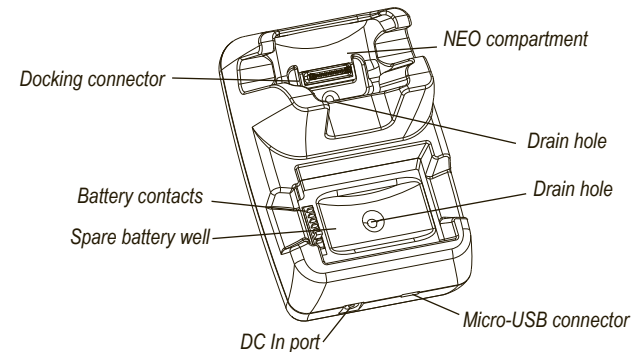
Mounting The Desktop Docking Station

The Desktop Docking Station can be fixed to the optional Wall Mount Bracket (model PX3011), or to another surface, by two broad-headed screws.

Rubber feet (quantity 4)

Mounting holes (quantity 2)

Mounting screw (quantity 2)

Note: The position of the mounting holes is indicated by markings on the front and sides of the Desktop Docking Station.

Insert the screws into the holes on the base of the unit, then slide the unit towards the back to secure it.
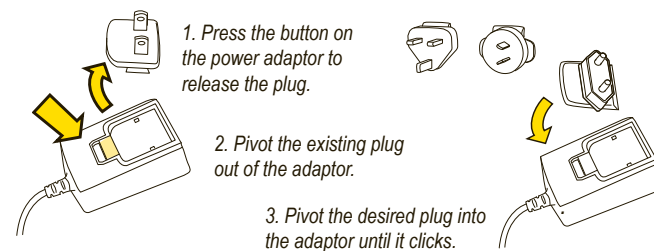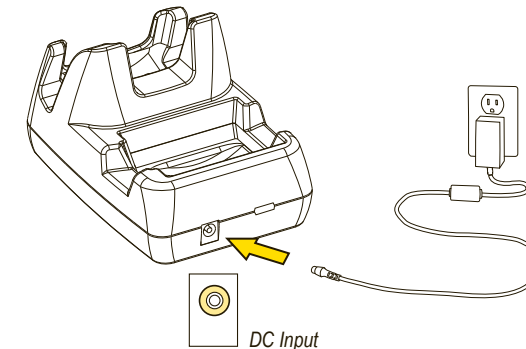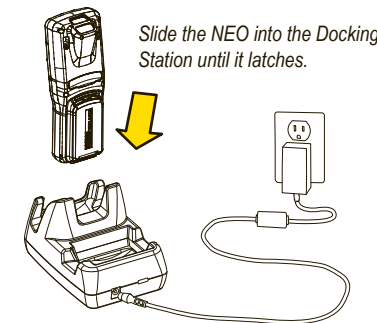
Getting Started

1 **Choose a plug for the universal power adaptor.** The adaptor may already be fitted with the plug you need.

1. Press the button on the power adaptor to release the plug.

2. Pivot the existing plug out of the adaptor.

3. Pivot the desired plug into the adaptor until it clicks.

2 **Connect the Docking Station to external power.**

DC Input

3 **Insert the NEO to charge its battery.**

Slide the NEO into the Docking Station until it latches.
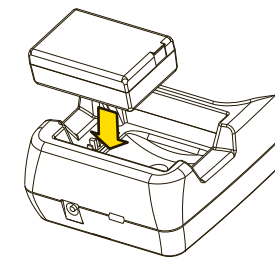
Note: Use only the universal AC power supply approved by Psion Teklogix for use with the Docking Station.

4 **Insert the spare battery.**

Note: During charge, the LED indicator on the NEO is YELLOW until charging reaches 75%. Between 75% and 95% the indicator flashes GREEN slowly, and, above 95%, the indicator is GREEN continuously.
The LED indicator on the Docking Station behaves the same when a spare battery is being charged.

Allow the NEO and the spare battery to charge for three hours before first use.
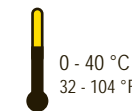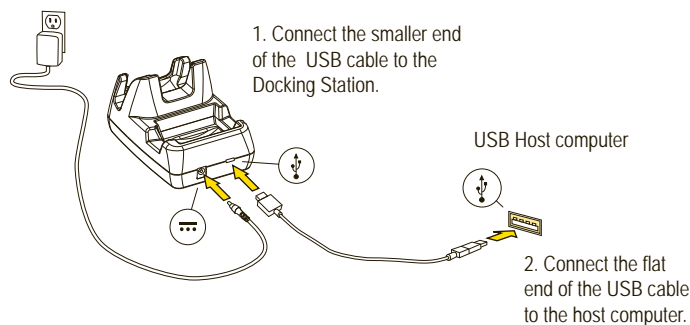
0 - 40 °C
32 - 104 °F

3 h

Note: Full battery performance is only reached after the first few charge/discharge cycles.
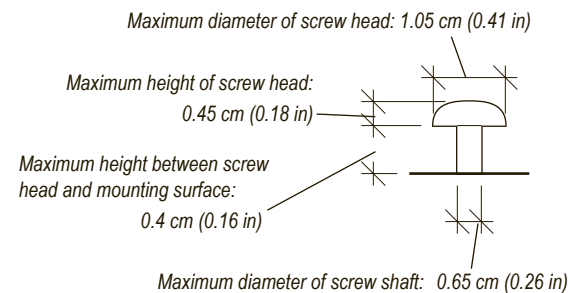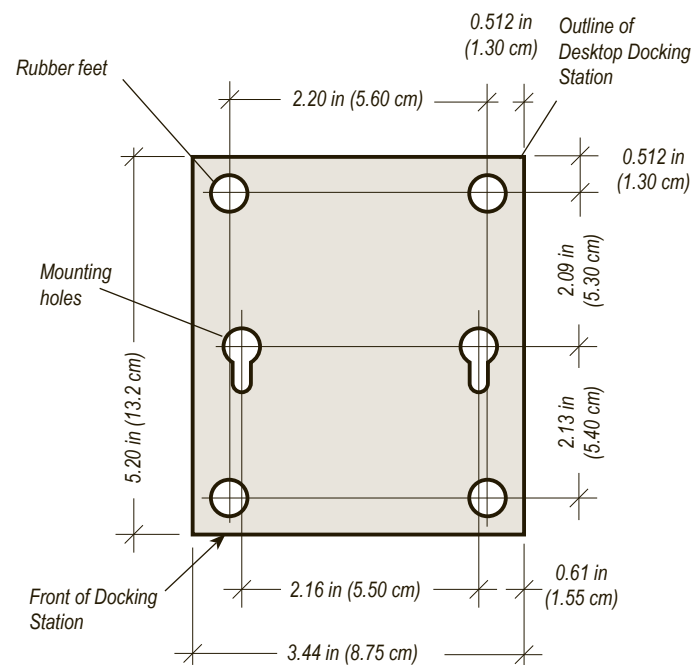
To connect the Docking Station to a host computer:

The NEO in the Docking Station acts as a USB Client.

1. Connect the smaller end of the USB cable to the Docking Station.

USB Host computer

2. Connect the flat end of the USB cable to the host computer.

Dimensions Of Mounting Screws

Maximum diameter of screw head: 1.05 cm (0.41 in)

Maximum height of screw head: 0.45 cm (0.18 in)

Maximum height between screw head and mounting surface: 0.4 cm (0.16 in)

Maximum diameter of screw shaft: 0.65 cm (0.26 in)

Location Guide For Mounting Screws

Rubber feet

Mounting holes

Front of Docking Station

0.512 in (1.30 cm)

Outline of Desktop Docking Station

2.20 in (5.60 cm)

0.512 in (1.30 cm)

2.09 in (5.30 cm)

2.13 in (5.40 cm)

5.20 in (13.2 cm)

2.16 in (5.50 cm)

0.61 in (1.55 cm)

3.44 in (8.75 cm)

The mounting screws are M4 x 6mm panhead screws.

NEO™

PX3001
Desktop Docking Station

Quick Start Guide
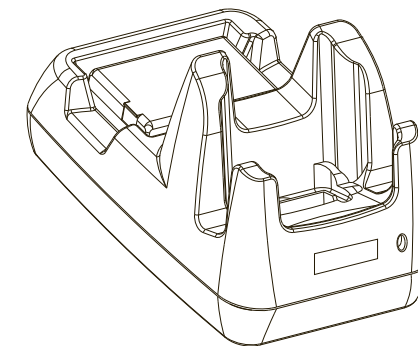
ISO 9001 Certified
Quality Management System

8100176
Rev. A

PSION TEKLOGIX